


Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-137	Smoke	11/17/2008	ADS/TM	S11SS1014MH	Dry	Yes	1,263.36

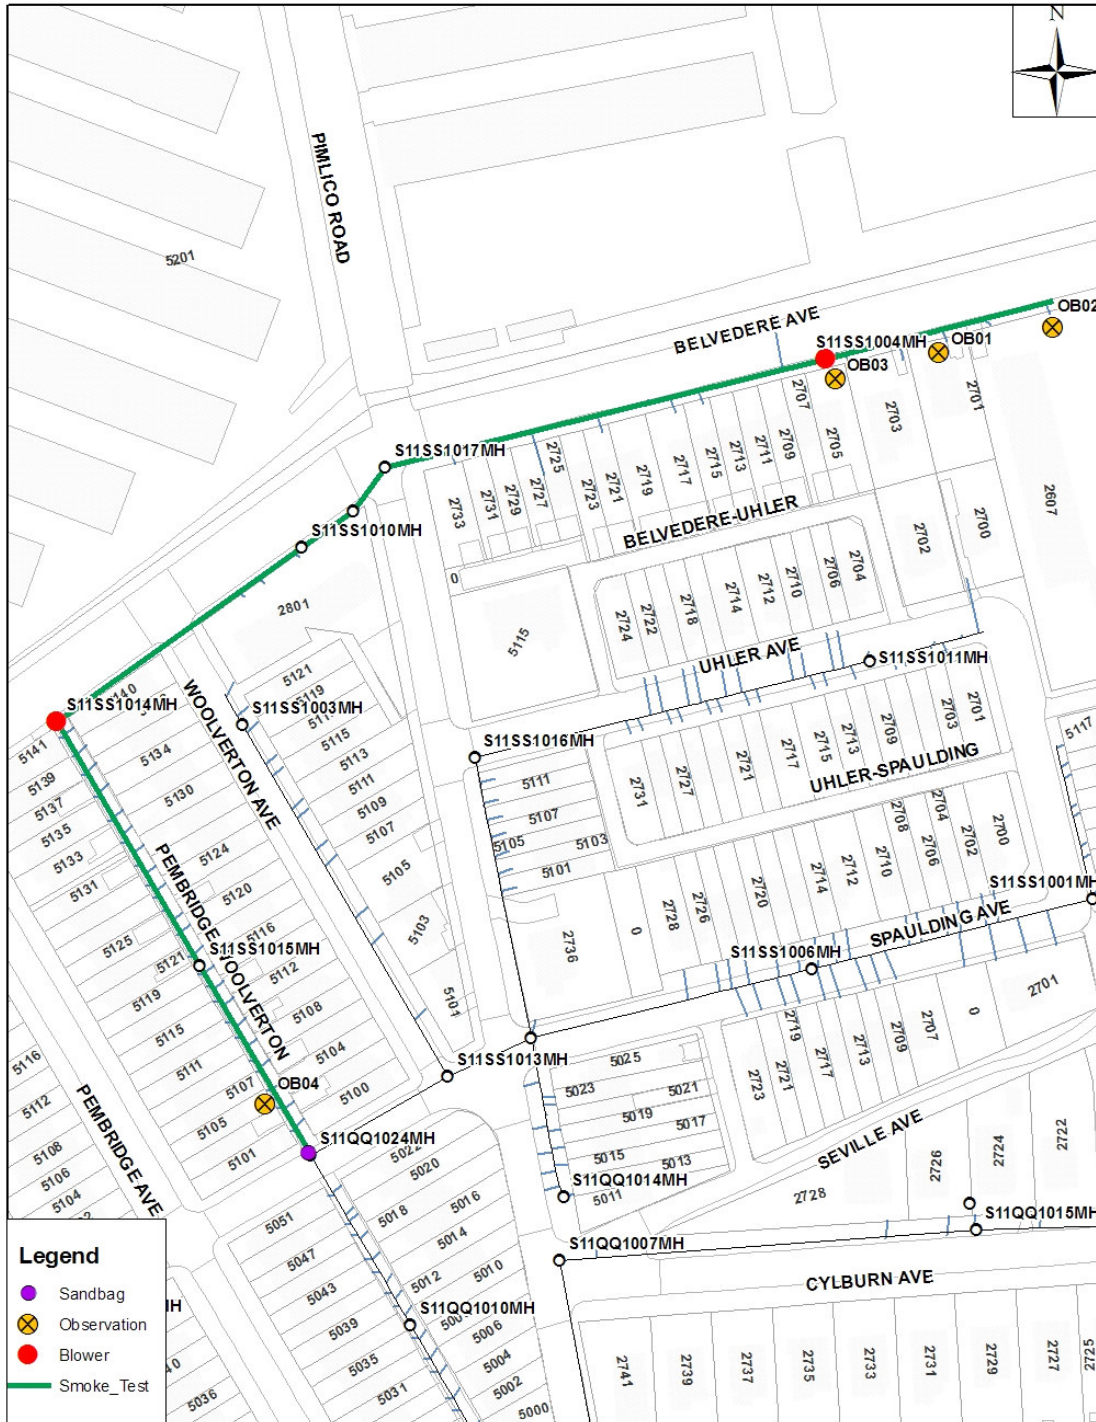

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-137	Smoke	11/17/2008	ADS/TM	S11SS1014MH	Dry	Yes	1,263.36

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S11SS1020G1	S11SS1020DE	S11SS1004MH	183.8817	8
S11SS1004G1	S11SS1004MH	S11SS1017MH	356.5280	8
S11SS1017G1	S11SS1017MH	S11SS1002MH	42.61087	8
S11SS1002G1	S11SS1002MH	S11SS1010MH	49.49542	8
S11SS1010G1	S11SS1010MH	S11SS1014MH	236.0172	8
S11SS1014G1	S11SS1014MH	S11SS1015MH	222.2571	8
S11SS1015G1	S11SS1015MH	S11QQ1024MH	172.5671	8

Observations & Photos

Obs_ID S1028-137-OB01

Address 2701 Belvedere Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S11SS1004MH

Comments Smoke from cleanout in front yard. 2701 Belvedere Ave.



Picture \S1028-137-OB01-P01.jpg

Comments Front of house, 2701 Belvedere Ave.

Obs_ID S1028-137-OB02

Address 2607 Belvedere Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S11SS1004MH

Comments Smoke from cleanout in front yard of apartments. 2607 Belvedere Ave.



Picture \S1028-137-OB02-P01.jpg

Comments Front of apartments, 2607 Belvedere Ave.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary

Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length
S1028-137	Smoke	11/17/2008	ADS/TM	S11SS1014MH	Dry	Yes	1,263.36

Obs_ID S1028-137-OB03

Address 2705 Belvedere Ave

Status Private

Source Cleanout

Location Yard - front

Nearest MH S11SS1004MH

Comments Smoke from cleanout in front yard. 2705 Belvedere Ave.



Picture \S1028-137-OB03-P01.jpg

Comments Front of house, 2705 Belvedere Ave.

Obs_ID S1028-137-OB04

Address 5105 Pembridge Ave


Status Private

Source Cleanout

Location Yard - back

Nearest MH S11QQ1024MH

Comments Smoke from cleanout in back yard. 5105 Pembridge Ave.

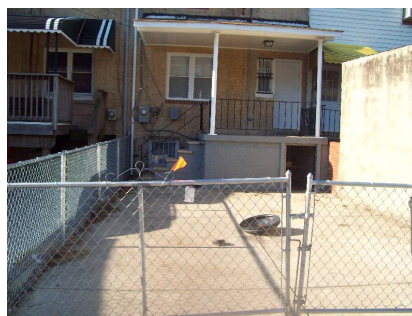

Picture \S1028-137-OB04-P01.jpg

Comments Back of house, 5105 Pembridge Ave.